



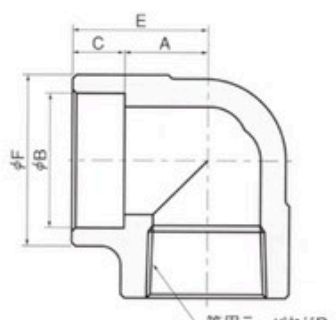

※全接続口が、ねじ込:Rc(PT)もあります。

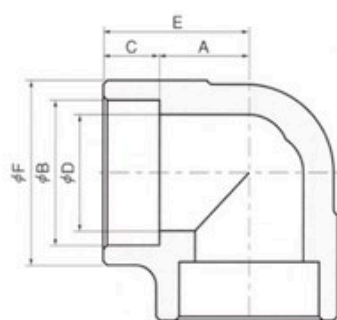

炭素鋼

ステンレス鋼

Sch80

※炭素鋼は2欄、ステンレス鋼は1欄

mm

A呼称	B呼称	B	F	C	D(1欄)	D(2欄)	A	E
8A	1/4	14.3	23.0	10.0	9.4	7.8	11.1	21.1
10A	3/8	17.8	28.0	11.0	12.7	10.9	13.5	24.5
15A	1/2	22.2	33.0	13.0	16.1	14.3	15.9	28.9
20A	3/4	27.7	38.0	14.0	21.4	19.4	19.1	33.1
25A	1	34.5	47.0	16.0	27.2	25.0	22.2	38.2
32A	1-1/4	43.2	57.0	18.0	35.5	32.9	27.0	45.0
40A	1-1/2	49.1	63.0	19.0	41.2	38.4	31.8	50.8
50A	2	61.1	76.0	22.0	52.7	49.5	38.1	60.1
65A	2-1/2	77.1	96.0	26.0	65.9	62.3	41.3	67.3
						—	47.5	73.5
80A	3	90.0	110.0	29.0	78.1	73.9	57.2	86.2
100A	4	115.4	138.0	35.0	102.3	97.1	72.5	107.5

※1 炭素鋼、ステンレス鋼で、両方の接続方式が差込み式の場合の寸法です。

※2 炭素鋼で、どちらか一方、または両方の接続方式がねじ込式の場合の寸法です。

※1

※2

Sch160

※炭素鋼、ステンレス鋼共通

mm

A呼称	B呼称	B	F	C	D	A	E
15A	1/2	22.2	38.0	14.0	12.3	19.1	33.1
20A	3/4	27.7	47.0	16.0	16.2	22.2	38.2
25A	1	34.5	57.0	18.0	21.2	27.0	45.0
32A	1-1/4	43.2	63.0	19.0	29.9	31.8	50.8
40A	1-1/2	49.1	76.0	22.0	34.4	38.1	60.1
50A	2	61.1	96.0	25.0	43.1	41.3	66.3
65A	2-1/2	77.1	110.0	28.0	57.3	57.2	85.2
80A	3	90.0	128.0	31.0	66.9	63.5	94.5