



レジュース (差込み: SW)

炭素鋼

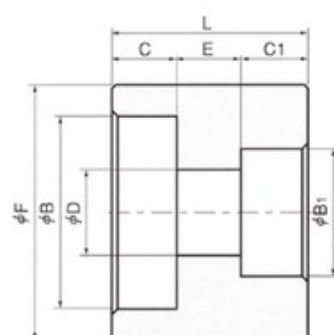

同心

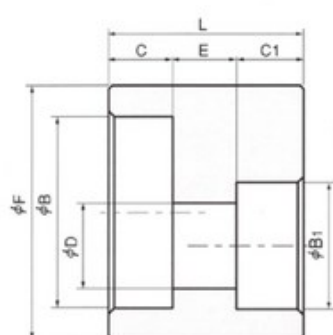

偏心



Sch80

※炭素鋼									mm
A呼称	B呼称	B	B1	F	C	C1	D	E	L
10A×8A	3/8×1/4	17.8	14.3	27.0	13.0	10.0	7.8	6.4	29.4
15A×8A	1/2×1/4	22.2	14.3	32.0	13.0	10.0	7.8	9.5	32.5
15A×10A	1/2×3/8	22.2	17.8	32.0	13.0	13.0	10.9	9.5	35.5
20A×8A	3/4×1/4	27.7	14.3	38.0	15.0	10.0	7.8	9.5	34.5
20A×10A	3/4×3/8	27.7	17.8	38.0	15.0	13.0	10.9	9.5	37.5
20A×15A	3/4×1/2	27.7	22.2	38.0	15.0	13.0	14.3	9.5	37.5
25A×10A	1×3/8	34.5	17.8	46.0	16.0	13.0	10.9	12.7	41.7
25A×15A	1×1/2	34.5	22.2	46.0	16.0	13.0	14.3	12.7	41.7
25A×20A	1×3/4	34.5	27.7	46.0	16.0	15.0	19.4	12.7	43.7
32A×15A	1-1/4×1/2	43.2	22.2	57.0	18.0	13.0	14.3	12.7	43.7
32A×20A	1-1/4×3/4	43.2	27.7	57.0	18.0	15.0	19.4	12.7	45.7
32A×25A	1-1/4×1	43.2	34.5	57.0	18.0	16.0	25.0	12.7	46.7
40A×15A	1-1/2×1/2	49.1	22.2	63.0	19.0	13.0	14.3	12.7	44.7
40A×20A	1-1/2×3/4	49.1	27.7	63.0	19.0	15.0	19.4	12.7	46.7
40A×25A	1-1/2×1	49.1	34.5	63.0	19.0	16.0	25.0	12.7	47.7
40A×32A	1-1/2×1-1/4	49.1	43.2	63.0	19.0	18.0	32.9	12.7	49.7
50A×20A	2×3/4	61.1	27.7	75.0	22.0	15.0	19.4	19.1	56.1
50A×25A	2×1	61.1	34.5	75.0	22.0	16.0	25.0	19.1	57.1
50A×32A	2×1-1/4	61.1	43.2	75.0	22.0	18.0	32.9	19.1	59.1
50A×40A	2×1-1/2	61.1	49.1	75.0	22.0	19.0	38.4	19.1	60.1
65A×25A	2-1/2×1	77.1	34.5	95.0	26.0	16.0	25.0	19.1	61.1
65A×32A	2-1/2×1-1/4	77.1	43.2	95.0	26.0	18.0	32.9	19.1	63.1
65A×40A	2-1/2×1-1/2	77.1	49.1	95.0	26.0	19.0	38.4	19.1	64.1
65A×50A	2-1/2×2	77.1	61.1	95.0	26.0	22.0	49.5	19.1	67.1
80A×32A	3×1-1/4	90.0	43.2	110.0	29.0	18.0	32.9	19.1	66.1
80A×40A	3×1-1/2	90.0	49.1	110.0	29.0	19.0	38.4	19.1	67.1
80A×50A	3×2	90.0	61.1	110.0	29.0	22.0	49.5	19.1	70.1
80A×65A	3×2-1/2	90.0	77.1	110.0	29.0	26.0	52.3	19.1	74.1

Sch160

※炭素鋼									mm
A呼称	B呼称	B	B1	F	C	C1	D	E	L
20A×15A	3/4×1/2	27.7	22.2	42.0	16.0	14.0	12.3	9.5	39.5
25A×15A	1×1/2	34.5	22.2	50.0	18.0	14.0	12.3	12.7	44.7
25A×20A	1×3/4	34.5	27.7	50.0	18.0	16.0	16.2	12.7	46.7
32A×15A	1-1/4×1/2	43.2	22.2	60.0	19.0	14.0	12.3	12.7	45.7
32A×20A	1-1/4×3/4	43.2	27.7	60.0	19.0	16.0	16.2	12.7	47.7
32A×25A	1-1/4×1	43.2	34.5	60.0	19.0	18.0	21.2	12.7	49.7
40A×15A	1-1/2×1/2	49.1	22.2	70.0	22.0	14.0	12.3	12.7	48.7
40A×20A	1-1/2×3/4	49.1	27.7	70.0	22.0	16.0	16.2	12.7	50.7
40A×25A	1-1/2×1	49.1	34.5	70.0	22.0	18.0	21.2	12.7	52.7
40A×32A	1-1/2×1-1/4	49.1	43.2	70.0	22.0	19.0	29.9	12.7	53.7
50A×20A	2×3/4	61.1	27.7	85.0	25.0	16.0	16.2	19.1	60.1
50A×25A	2×1	61.1	34.5	85.0	25.0	18.0	21.2	19.1	62.1
50A×32A	2×1-1/4	61.1	43.2	85.0	25.0	19.0	29.9	19.1	63.1
50A×40A	2×1-1/2	61.1	49.1	85.0	25.0	22.0	34.4	19.1	66.1

※ 偏心についてはお問い合わせください。