



レジャーサ (差込み:SW)

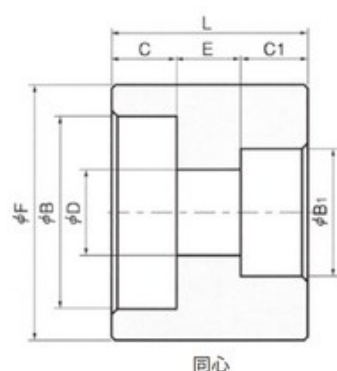

同心

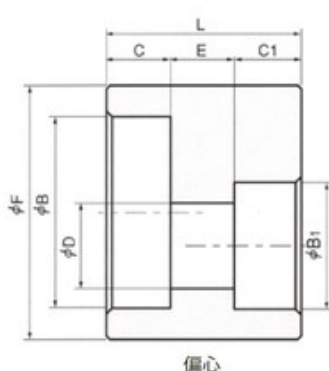

偏心



ステンレス鋼

Sch80

※ステンレス鋼 ※Cは最小寸法を示します。

									mm
A呼称	B呼称	B	B1	F	C	C1	D	E	L
10A×8A	3/8×1/4	17.8	14.3	28.0	9.6	9.6	9.4	6.4	25.6
15A×8A	1/2×1/4	22.2	14.3	32.0	9.6	9.6	9.4	9.5	28.7
15A×10A	1/2×3/8	22.2	17.8	32.0	9.6	9.6	12.7	9.5	28.7
20A×8A	3/4×1/4	27.7	14.3	38.0	12.7	9.6	9.4	9.5	31.8
20A×10A	3/4×3/8	27.7	17.8	38.0	12.7	9.6	12.7	9.5	31.8
20A×15A	3/4×1/2	27.7	22.2	38.0	12.7	9.6	16.1	9.5	31.8
25A×10A	1×3/8	34.5	17.8	46.0	12.7	9.6	12.7	12.7	35.0
25A×15A	1×1/2	34.5	22.2	46.0	12.7	9.6	16.1	12.7	35.0
25A×20A	1×3/4	34.5	27.7	46.0	12.7	12.7	21.4	12.7	38.1
32A×15A	1-1/4×1/2	43.2	22.2	55.0	12.7	9.6	16.1	12.7	35.0
32A×20A	1-1/4×3/4	43.2	27.7	55.0	12.7	12.7	21.4	12.7	38.1
32A×25A	1-1/4×1	43.2	34.5	55.0	12.7	12.7	27.2	12.7	38.1
40A×15A	1-1/2×1/2	49.1	22.2	65.0	12.7	9.6	16.1	12.7	35.0
40A×20A	1-1/2×3/4	49.1	27.7	65.0	12.7	12.7	21.4	12.7	38.1
40A×25A	1-1/2×1	49.1	34.5	65.0	12.7	12.7	27.2	12.7	38.1
40A×32A	1-1/2×1-1/4	49.1	43.2	65.0	12.7	12.7	35.5	12.7	38.1
50A×20A	2×3/4	61.1	27.7	75.0	15.9	12.7	21.4	19.1	47.7
50A×25A	2×1	61.1	34.5	75.0	15.9	12.7	27.2	19.1	47.7
50A×32A	2×1-1/4	61.1	43.2	75.0	15.9	12.7	35.5	19.1	47.7
50A×40A	2×1-1/2	61.1	49.1	75.0	15.9	12.7	41.2	19.1	47.7
65A×25A	2-1/2×1	77.1	34.5	95.0	15.9	12.7	27.2	19.1	47.7
65A×32A	2-1/2×1-1/4	77.1	43.2	95.0	15.9	12.7	35.5	19.1	47.7
65A×40A	2-1/2×1-1/2	77.1	49.1	95.0	15.9	12.7	41.2	19.1	47.7
65A×50A	2-1/2×2	77.1	61.1	95.0	15.9	15.9	52.7	19.1	50.9
80A×32A	3×1-1/4	90.0	43.2	110.0	15.9	12.7	35.5	19.1	47.7
80A×40A	3×1-1/2	90.0	49.1	110.0	15.9	12.7	41.2	19.1	47.7
80A×50A	3×2	90.0	61.1	110.0	15.9	15.9	52.7	19.1	50.9
80A×65A	3×2-1/2	90.0	77.1	110.0	15.9	15.9	65.9	19.1	50.9
					※	※			

※ C、C1寸法は、JIS B 2316「配管用鋼製差込み溶接式管継手」の差込み部の深さ(最小)の値を示しており、実寸はこの値より0.1～0.4程度大きくなっています。

Sch160

※ステンレス鋼

									mm
A呼称	B呼称	B	B1	F	C	C1	D	E	L
20A×15A	3/4×1/2	27.7	22.2	42.0	12.7	9.6	12.3	9.5	31.8
25A×15A	1×1/2	34.5	22.2	50.0	12.7	9.6	12.3	12.7	35.0
25A×20A	1×3/4	34.5	27.7	50.0	12.7	12.7	16.2	12.7	38.1
32A×15A	1-1/4×1/2	43.2	22.2	60.0	12.7	9.6	12.3	12.7	35.0
32A×20A	1-1/4×3/4	43.2	27.7	60.0	12.7	12.7	16.2	12.7	38.1
32A×25A	1-1/4×1	43.2	34.5	60.0	12.7	12.7	21.2	12.7	38.1
40A×15A	1-1/2×1/2	49.1	22.2	70.0	12.7	9.6	12.3	12.7	35.0
40A×20A	1-1/2×3/4	49.1	27.7	70.0	12.7	12.7	16.2	12.7	38.1
40A×25A	1-1/2×1	49.1	34.5	70.0	12.7	12.7	21.2	12.7	38.1
40A×32A	1-1/2×1-1/4	49.1	43.2	70.0	12.7	12.7	29.9	12.7	38.1
50A×20A	2×3/4	61.1	27.7	85.0	15.9	12.7	16.2	19.1	47.7
50A×25A	2×1	61.1	34.5	85.0	15.9	12.7	21.2	19.1	47.7
50A×32A	2×1-1/4	61.1	43.2	85.0	15.9	12.7	29.9	19.1	47.7
50A×40A	2×1-1/2	61.1	49.1	85.0	15.9	12.7	34.4	19.1	47.7
					※	※			

※ C、C1寸法は、JIS B 2316「配管用鋼製差込み溶接式管継手」の差込み部の深さ(最小)の値を示しており、実寸はこの値より0.1～0.4程度大きくなっています。

※ 偏心レジャーサについてはお問い合わせください。